

**Flood Control Project Maintenance
Levee Inspections
LMA District Cover Sheet
Spring 2010 Levee Inspection Results**

Sutter Maintenance Yard East-West Interceptor

	Spring (March - May)	Summer ** (June - August)	Fall (September - November)	Winter ** (December - February)
* Overall LMA Rating (Fall Only)				

** Non-receipt of Summer or Winter Inspection Reports may effect overall annual rating.

*

SPRING INSPECTIONS: Overall maintenance ratings are not determined for the spring inspection results. Individual maintenance deficiencies are rated using the same criteria in the spring and in the fall.

FALL INSPECTIONS: The overall maintenance rating shown above is based on operation and maintenance deficiencies identified within the attached unit inspection reports.

Comments

**Flood Control Project Maintenance
Levee Inspections**

Unit Cover Sheet

Spring 2010 Levee Inspection Results

Sutter Maintenance Yard East-West Interceptor

Waterway				Bank	Unit Miles
Unit No. 01 West Levee				Right	1.75
	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)	
Unit Maintenance Rating (Fall Only)					
Date of Inspection	4/30/2010 - 4/30/2010				
DWR Inspector	Bob Duffey				
Accompanied By	Steve Beckley Sutter Yard				

Check one:

- ☐ During the current winter (or summer) inspection period, my staff or I have inspected the levee and associated flood project components identified in the attached Levee Inspection Report by Mile. We have found no changes in flood project conditions other than the results of our normal maintenance and the corrections we have made to maintenance deficiencies identified in the enclosed report.
- ☐ During the current winter (or summer) inspection period, my staff or I have inspected the levee and associated flood project components identified in the attached Levee Inspection Report by Mile. In addition to the results of our normal maintenance and the corrections we have made to maintenance deficiencies identified in the report, we have found the following changes in flood project conditions.

(In the comment section below or on additional sheet(s), identify change of condition by: Start to End Levee Mile or GPS coordinates, location (Land Side, Water Side, or Crown), Item identification, and description of the current condition).

Comments

One of the boxes above is to be checked by the Local Maintaining Agency (LMA). If the second box is checked, additional information must also be submitted. This Unit Cover Sheet should be signed and dated by the LMA Representative and returned to DWR with any additional sheets by September 30 (Summer Inspection) or March 31 (Winter Inspection). Please retain a copy for your records. Please mail all of this information to :

DWR Summer/Winter Inspection Reports
3310 El Camino Avenue, Room LL-30
Sacramento, CA 95821-9000

X

Signature of LMA Representative

Date

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2010

Sutter Maintenance Yard East-West Interceptor

Waterway						Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 West Levee						Right	1.75	04/30/2010 04/30/2010	Bob Duffey

LMR No	Levee Mile		Category	Item	Location *	Rating **	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End						Start	End	
1	0.23	0.25	Earthen Levee	Encroachments	LS	PO	Landscaping	39.171418 ° -121.755963 °	39.171408 ° -121.755578 °	2
2	0.62	0.65	Earthen Levee	Erosion / Bank Caving	LS	M	Schedule repair of erosion site prior to the next inspection.	39.171292 ° -121.748868 °	39.171232 ° -121.748175 °	4 Y
3	1.67	1.67	Earthen Levee	Erosion / Bank Caving	LS	M	Note and monitor erosion site.	39.171133 ° -121.729265 °	39.171133 ° -121.729265 °	5 Y

*** Location**

LS : Land Side
WS : Water Side
CR : Crown

**** Rating**

A : Acceptable PO : Partially Obstructing C : Corrected
M : Minimally Acceptable CO : Completely Obstructing W : Watch/Monitor
U : Unacceptable N : Not Inspected

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2010

Sutter Maintenance Yard East-West Interceptor

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 West Levee	Right	1.75	04/30/2010 04/30/2010	Bob Duffey

Levee Mile Report Line	2
Start Levee Mile	0.62
End Levee Mile	0.65
Location	Land Side
Category	Earthen Levee
Item	Erosion / Bank Caving

View of the erosion along the concrete ditch on the waterside slope.

rduffey_s_20100616_053.jpg



Levee Mile Report Line	3
Start Levee Mile	1.67
End Levee Mile	1.67
Location	Land Side
Category	Earthen Levee
Item	Erosion / Bank Caving

View of the erosion along the waterside slope.

rduffey_s_20100616_054.jpg



*** Location**

LS : Land Side
WS : Water Side
CR : Crown

**** Rating**

A : Acceptable PO : Partially Obstructing C : Corrected
M : Minimally Acceptable CO : Completely Obstructing W : Watch/Monitor
U : Unacceptable N : Not Inspected

**Flood Control Project Maintenance
Levee Inspections**

Unit Cover Sheet

Spring 2010 Levee Inspection Results

Sutter Maintenance Yard East-West Interceptor

Waterway				Bank	Unit Miles
Unit No. 02 East Levee				Left	3.01
	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)	
Unit Maintenance Rating (Fall Only)					
Date of Inspection	5/24/2010 - 5/24/2010				
DWR Inspector	Bob Duffey				
Accompanied By	Steve Beckley Sutter Yard				

Check one:

- ☐ During the current winter (or summer) inspection period, my staff or I have inspected the levee and associated flood project components identified in the attached Levee Inspection Report by Mile. We have found no changes in flood project conditions other than the results of our normal maintenance and the corrections we have made to maintenance deficiencies identified in the enclosed report.
- ☐ During the current winter (or summer) inspection period, my staff or I have inspected the levee and associated flood project components identified in the attached Levee Inspection Report by Mile. In addition to the results of our normal maintenance and the corrections we have made to maintenance deficiencies identified in the report, we have found the following changes in flood project conditions.

(In the comment section below or on additional sheet(s), identify change of condition by: Start to End Levee Mile or GPS coordinates, location (Land Side, Water Side, or Crown), Item identification, and description of the current condition).

Comments

One of the boxes above is to be checked by the Local Maintaining Agency (LMA). If the second box is checked, additional information must also be submitted. This Unit Cover Sheet should be signed and dated by the LMA Representative and returned to DWR with any additional sheets by September 30 (Summer Inspection) or March 31 (Winter Inspection). Please retain a copy for your records. Please mail all of this information to :

DWR Summer/Winter Inspection Reports
3310 El Camino Avenue, Room LL-30
Sacramento, CA 95821-9000

X

Signature of LMA Representative

Date

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2010

Sutter Maintenance Yard East-West Interceptor

Waterway						Bank	Unit Miles	Inspection Start/End	Inspector	
Unit No. 02 East Levee						Left	3.01	05/24/2010 05/24/2010	Bob Duffey	

LMR No	Levee Mile		Category	Item	Location *	Rating **	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End						Start	End	
1	0.55	1.55	Earthen Levee	Vegetation	LS	M	Remove the wild growth other than native grasses from the levee slopes.	39.171002 ° -121.716293 °	39.170817 ° -121.698202 °	1 Y
2	0.55	2.72	Earthen Levee	Vegetation	WS	M	Remove the wild growth other than native grasses from the levee slopes.	39.171002 ° -121.716293 °	39.170507 ° -121.676212 °	2 Y
3	1.43	1.55	Earthen Levee	Encroachments	LS	M	Debris	39.170782 ° -121.700167 °	39.170817 ° -121.698203 °	3 Y
4	1.54	1.93	Earthen Levee	Erosion / Bank Caving	WS	M	Note and monitor erosion site.	39.170800 ° -121.698105 °	39.170702 ° -121.690788 °	4 Y
5	1.92	2.04	Earthen Levee	Encroachments	LS	M	Equipment	39.171104 ° -121.718880 °	39.171104 ° -121.718876 °	5 Y

*** Location**

LS : Land Side
WS : Water Side
CR : Crown

**** Rating**

A : Acceptable PO : Partially Obstructing C : Corrected
M : Minimally Acceptable CO : Completely Obstructing W : Watch/Monitor
U : Unacceptable N : Not Inspected

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2010

Sutter Maintenance Yard East-West Interceptor

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 East Levee	Left	3.01	05/24/2010 05/24/2010	Bob Duffey

Levee Mile Report Line	1
Start Levee Mile	0.55
End Levee Mile	1.55
Location	Land Side
Category	Earthen Levee
Item	Vegetation

View of the grasses and vegetation on both slopes.

rduffey_s_20100616_056.jpg



Levee Mile Report Line	3
Start Levee Mile	1.43
End Levee Mile	1.55
Location	Land Side
Category	Earthen Levee
Item	Encroachments

View of the pile of broken concrete next to the levee.

rduffey_s_20100622_075.jpg



Levee Mile Report Line	4
Start Levee Mile	1.54
End Levee Mile	1.93
Location	Water Side
Category	Earthen Levee
Item	Erosion / Bank Caving

View of the erosion along the waterside slope.

rduffey_s_20100622_076.jpg



*** Location**

LS : Land Side
WS : Water Side
CR : Crown

**** Rating**

A : Acceptable
M : Minimally Acceptable
U : Unacceptable
PO : Partially Obstructing
CO : Completely Obstructing
N : Not Inspected
C : Corrected
W : Watch/Monitor

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2010

Sutter Maintenance Yard East-West Interceptor

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 East Levee	Left	3.01	05/24/2010 05/24/2010	Bob Duffey

Levee Mile Report Line	5
Start Levee Mile	1.92
End Levee Mile	2.04
Location	Land Side
Category	Earthen Levee
Item	Encroachments

View of the equipment and buildings along a landside berm.

rduffey_s_20100622_077.jpg



Levee Mile Report Line	5
Start Levee Mile	1.92
End Levee Mile	2.04
Location	Land Side
Category	Earthen Levee
Item	Encroachments

View of the equipment and buildings next to the landside berm.

rduffey_s_20100628_098.jpg



*** Location**

LS : Land Side
WS : Water Side
CR : Crown

**** Rating**

A : Acceptable PO : Partially Obstructing C : Corrected
M : Minimally Acceptable CO : Completely Obstructing W : Watch/Monitor
U : Unacceptable N : Not Inspected